
City of Baltimore Wet Smoke and Dyed	Page 1 of 2	
Sewershed: Gwynns Falls	Date: 4/20/2009	
Test to be performed: Smoke Dyed Water X	Ground Condition: Dry ✓ Damp □ Wet □	Supervisor: JAW
Manhole_ID: S05II1015MH	Test ID: <u>D1032-034041</u>	Notification Made: NA (Residents, Fire, 311)

Field Sketch: Show all manholes with Numbers, Blower Placement Locations, Sandbag or Isolation Locations, Street Names, Building Addresses and Locations, Defect Locations and Photo Numbers.

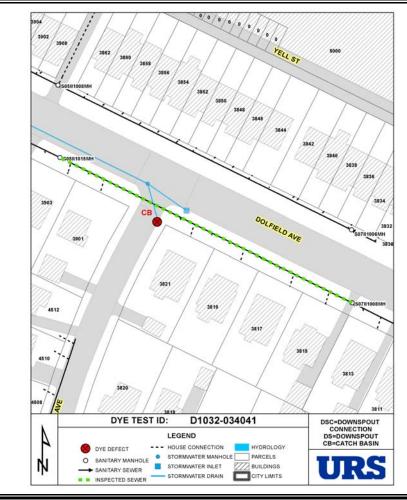

Defect Loc	Obs_ClockFrom	Obs_ClockTo	Observation	Obs_Remarks	
0			Start of Survey		
0			Manhole	S05II1015MH	
0			Water Level		
92.40000153	10	02	Infil Gusher		
92.40000153			Dye Test Visible	@ IG, 5gpm	
94.59999847	10	02	Infil Gusher	@ jt	
94.59999847			Dye Test Visible	@ IG, 3.5gpm	
98.30000305	11	01	Infil Gusher	@ jt	
98.30000305			Dye Test Visible	@ IG, 2gpm	
101	02	10	Infil Gusher	@jt	
101			Dye Test Visible	@ IG, 5gpm	

City of Baltimore Wet Weather Consent Decree Smoke and Dyed Water Testing Form					Page 2 of 2
Sewershed: Gwynns Falls			Company: Savin		Date: 4/20/2009
Test to be per	rformed: Dyed Water <u>X</u>	, <u>:</u>	Ground Condition: Dry ✓ Damp ☐	Wet	Supervisor: <u>JAW</u>
Manhole_ID:	<u>S05II1015MH</u>		Test ID: <u>D1032-034041</u>		Notification Made: NA (Residents, Fire, 311)
104.4000015	03		Infil Runner	@ jt, no o	dye seen
110.0999985	03		Infil Runner	@ jt, no o	dye seen
113.0999985	10		I1 Infil Runner	@ jt, no o	dye seen
116.4000015	09		Infil Runner	@ jt	
116.4000015			Dye Test Visible	@ IR, 0.1	gpm, dye is intermittent
119.4000015	02		Infil Runner	@ jt, no o	dye seen
125.6999969	08		Infil Runner	@ jt, no d	dye seen
134.1999969			Abandoned Survey	COMPLE	TED DYE FLOOD